

Work Order ID 119968

June-02-14 10:33:10 AM

119968

Page 1

Item ID: D212-664-101TRN

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Item Name: Crosstube Turning Detail

Stop ***NS2***

Start Date: 6/02/14 Start Qty: 1.00

1

Cust Item ID:

Required Date: 6/02/14 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: MLS

Date: 14-06-02 Tooling:

Date:

Run Start ***NR1***

QC:

Date:

SPC (Y/N):

Date:

Stop ***NR2***

| Sequence ID/ Work Center ID | Operation Description | Set Up/ Run Hours | Tool ID | Tool # | Plan Code | Accept Qty | Reject Qty | Reject Number | Insp. Stamp |
|--------------------------------|--------------------------|----------------------|---------|--------|--------------|---------------|---------------|------------------|----------------|
|--------------------------------|--------------------------|----------------------|---------|--------|--------------|---------------|---------------|------------------|----------------|

| Draw Nbr | Revision Nbr |
|----------|--------------|
|----------|--------------|

| | |
|--------------|-------------|
| D212-664-141 | Rev D (DEO) |
|--------------|-------------|

100

0.00

100

Mori Seiki

Mori Seiki CNC Lathe Large

MORI SEIKI CNC LATHE LARGE

Memo

0.00

1-Fill tube with sand & install plugs DT8534 on both ends as per Folio FA113

2-Turn first side as per Folio FA113

3-Blend transition lines only, **do not sand whole tube**

FOLIO REV: A

DWG REV: E

*Use mill bastard file, brush file repeatedly with file card.

*Do not use sandpaper coarser than 320 grit.

110

QC1- Inspect dimensions to dimension sheet

0.00

110

QC

Quality Control

Memo

0.00

mm 2
14/06/18

mm 2
14/06/14

DQA:

Date: 14/07/11

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed:

Date: 14/7/7

Work Order update only ☐

| | | | | | |
|---------------------------------|---|--|---|--|--------------------------------------|
| Work Order: <u>119968</u> | DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input checked="" type="checkbox"/> Suspected Unapproved <input type="checkbox"/> | AGAINST DEPARTMENT/PROCESS | | | |
| Part No. <u>D212-664-101TRN</u> | | Skid-tube <input type="checkbox"/> | Crosstube <input checked="" type="checkbox"/> | Water Jet <input type="checkbox"/> | Engineering <input type="checkbox"/> |
| NCR No. <u>14-4013</u> | | Machining <input type="checkbox"/> | Small Fab <input type="checkbox"/> | Prod. Eng. Coord. <input type="checkbox"/> | Quality <input type="checkbox"/> |
| | | Thermoforming <input type="checkbox"/> | Finishing <input type="checkbox"/> | Rec/Store/Packaging <input type="checkbox"/> | Other <input type="checkbox"/> |
| | | Large Fab <input type="checkbox"/> | Composite <input type="checkbox"/> | Supplier <input type="checkbox"/> | |

| Root Cause | Date | Step | Qty | Description of work order update or non-conformance | Initial Chief Eng | Action Description | Sign & Date | Verification | QC Inspector |
|--|---------|------|-----|---|---------------------------------|---|---------------------------------|----------------|----------------------------------|
| Design | 14/6/25 | 100 | 1 | Some Some ultra sonic well measurements are over tolerance. min well is up to 0.018 under dwg tolerance. | DAS 12 889 14/6/25 | Acceptable. within allowable tolerance of D6005 | DAS 12 889 14/6/25 | TW 14-06-26 | DAS 27 9-89 14/6/27 |
| Doc/Data | | | | | | | | | |
| Equip/Tooling | | | | | | | | | |
| Handling/Pre | | | | | | | | | |
| Material | | | | | | | | | |
| Operator | | | | | | | | | |
| Offset/Setup <input checked="" type="checkbox"/> | | | | | | | | | |
| Process | | | | | | | | | |
| Supplier | | | | | | | | | |
| Training | | | | | | | | | |
| Transport | | | | | | | | | |
| Unapproved | | | | | | | | | |

FAULT CATEGORY

| Landing Gear | General | | |
|---|---|--|--|
| <input type="checkbox"/> Bending | <input type="checkbox"/> Bend | <input type="checkbox"/> Folio/Program | <input type="checkbox"/> Outside Dimensions |
| <input type="checkbox"/> Centre Not Concentric | <input type="checkbox"/> BOM/Route | <input type="checkbox"/> Grain | <input checked="" type="checkbox"/> Over/Under tolerance |
| <input type="checkbox"/> Cracks | <input type="checkbox"/> Broken/Damage/Defect | <input type="checkbox"/> Hardware | <input type="checkbox"/> Part Incorrect |
| <input type="checkbox"/> Crimp/Kink/Ripple/Wave | <input type="checkbox"/> Burrs | <input type="checkbox"/> Inspection Incomplete/Unqualified | <input type="checkbox"/> Part Lost/Missing |
| <input type="checkbox"/> Cuffs | <input type="checkbox"/> Contamination | <input type="checkbox"/> Instructions Incomplete/Unclear | <input type="checkbox"/> Part Moved |
| <input type="checkbox"/> Crushing | <input type="checkbox"/> Countersink | <input type="checkbox"/> Misaligned/off center | <input type="checkbox"/> Positioned Wrong |
| <input type="checkbox"/> Heat Treat | <input type="checkbox"/> Cut Too Short | <input type="checkbox"/> Mislabeled | <input type="checkbox"/> Power Loss/Surge |
| <input type="checkbox"/> Inspection Strip in Tube | <input type="checkbox"/> Drawing | <input type="checkbox"/> Misread | <input type="checkbox"/> Pressure/Forced |
| <input type="checkbox"/> Marks/Chatter | <input type="checkbox"/> Drill Holes | <input type="checkbox"/> Off-set | <input type="checkbox"/> Set-up |
| <input type="checkbox"/> Turning Sequence | <input type="checkbox"/> Finish | <input type="checkbox"/> Out of Calibration | <input type="checkbox"/> Temperature/Cure |
| <input type="checkbox"/> Wave/Twist in Tube | <input type="checkbox"/> Fit/Function | <input type="checkbox"/> Out of Sequence | <input type="checkbox"/> Weld |
| | | | <input type="checkbox"/> Wrong Stock Pulled |
| | | | <input type="checkbox"/> Other |

Work Order ID 119968

June-02-14 10:33:10 AM

119968

Page 2

Item ID: D212-664-101TRN

Accept

N900040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: Crosstube Turning Detail

Start Date: 6/02/14

Start Qty: 1.00

1

Cust Item ID:

Required Date: 6/02/14

Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run

Start

NR1

QC:

Date:

SPC (Y/N):

Date:

Stop

NR2

Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

120

0.00

120

MORI SEIKI CNC LATHE LARGE

Mori Seiki

Memo

0.00

Mori Seiki CNC Lathe Large

1-Turn second side as per Folio FA113

2-Blend transition lines only, **do not sand whole tube**:

*Use mill bastard file, brush file repeatedly with file card.

*Do not use sandpaper coarser than 320 grit.

FOLIO REV: FD

DWG REV: E

3-Remove sand and plugs

1 / 0

mar.L
14/06/14

130

0.00

130

QC1- Inspect dimensions to dimension sheet

QC

Memo

0.00

Quality Control

+ PERFORM ULTRA SONIC MEASUREMENT

1 / 0

mar.L
14/06/14

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

| | | | | | | | | | | | | | | | | | | |
|--|--|---|--------------------------------------|------------------------------------|------------------------------------|--------------------------------------|------------------------------------|------------------------------------|--|----------------------------------|--|------------------------------------|--|--------------------------------|------------------------------------|------------------------------------|-----------------------------------|--|
| Work Order: _____ Part No. _____ NCR No. _____ | DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/> | AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table> | Skid-tube <input type="checkbox"/> | Crosstube <input type="checkbox"/> | Water Jet <input type="checkbox"/> | Engineering <input type="checkbox"/> | Machining <input type="checkbox"/> | Small Fab <input type="checkbox"/> | Prod. Eng. Coord. <input type="checkbox"/> | Quality <input type="checkbox"/> | Thermoforming <input type="checkbox"/> | Finishing <input type="checkbox"/> | Rec/Store/Packaging <input type="checkbox"/> | Other <input type="checkbox"/> | Large Fab <input type="checkbox"/> | Composite <input type="checkbox"/> | Supplier <input type="checkbox"/> | |
| Skid-tube <input type="checkbox"/> | Crosstube <input type="checkbox"/> | Water Jet <input type="checkbox"/> | Engineering <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Machining <input type="checkbox"/> | Small Fab <input type="checkbox"/> | Prod. Eng. Coord. <input type="checkbox"/> | Quality <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Thermoforming <input type="checkbox"/> | Finishing <input type="checkbox"/> | Rec/Store/Packaging <input type="checkbox"/> | Other <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Large Fab <input type="checkbox"/> | Composite <input type="checkbox"/> | Supplier <input type="checkbox"/> | | | | | | | | | | | | | | | | |

| Root Cause | Date | Step | Qty | Description of work order update or non-conformance | Initial Chief Eng | Action Description | Sign & Date | Verification | QC Inspector |
|---------------|------|------|-----|---|-------------------|--------------------|-------------|--------------|--------------|
| Design | | | | | | | | | |
| Doc/Data | | | | | | | | | |
| Equip/Tooling | | | | | | | | | |
| Handling/Pre | | | | | | | | | |
| Material | | | | | | | | | |
| Operator | | | | | | | | | |
| Offset/Setup | | | | | | | | | |
| Process | | | | | | | | | |
| Supplier | | | | | | | | | |
| Training | | | | | | | | | |
| Transport | | | | | | | | | |
| Unapproved | | | | | | | | | |

FAULT CATEGORY

| | | | |
|--|--|---|--|
| Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube | General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function | <input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence | <input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other |
|--|--|---|--|

Work Order ID 119968

June-02-14 10:33:10 AM

119968

Page 3

Item ID: D212-664-101TRN

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Item Name: Crosstube Turning Detail

Stop ***NS2***

Start Date: 6/02/14 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 6/02/14 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

| Sequence ID/ Work Center ID | Operation Description | Set Up/ Run Hours | Tool ID | Tool # | Plan Code | Accept Qty | Reject Qty | Reject Number | Insp. Stamp |
|--------------------------------|---|----------------------|---------|--------|--------------|---------------|---------------|------------------|----------------|
| 140 | QC8- Inspect parts - second check | 0.00 | | | | | | | |
| *140* | | | | | | | | | |
| QC | Memo | 0.00 | | | | | | | |
| Quality Control | + CHECK ULTRA SONIC MEASUREMENT AND ORIENTATION FOR BENDING | | | | | | | | |
| | | | | | | | | | |
| 145 | | 0.00 | | | | | | | |
| *145* | | | | | | | | | |
| Crosstubes | Memo | 0.00 | | | | | | | |
| Crosstubes | GRIND ONLY TRANSITION LINES SMOOTH LONGITUDE WAY. | | | | | | | | |
| | | | | | | | | | |
| 150 | | 0.00 | | | | | | | |
| *150* | | | | | | | | | |
| HandFXtube | Memo | 0.00 | | | | | | | |
| Hand Finishing Crosstubes | 1- PRESSURE WASH X-TUBE INSIDE AND OUT | | | | | | | | |
| | 2- ACID ETCH X-TUBE INSIDE AND OUT. USE RED SCOTCH BRITE | | | | | | | | |

JT 14-06-26

ac 14/06/26

BL/ac 14-06-26

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

| | | | | | | | | | | | | | | | | | | |
|--|--|--|--------------------------------------|------------------------------------|------------------------------------|--------------------------------------|------------------------------------|------------------------------------|--|----------------------------------|--|------------------------------------|--|--------------------------------|------------------------------------|------------------------------------|-----------------------------------|--|
| Work Order: _____ Part No. _____ NCR No. _____ | DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/> | AGAINST DEPARTMENT/PROCESS <table style="width:100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table> | Skid-tube <input type="checkbox"/> | Crosstube <input type="checkbox"/> | Water Jet <input type="checkbox"/> | Engineering <input type="checkbox"/> | Machining <input type="checkbox"/> | Small Fab <input type="checkbox"/> | Prod. Eng. Coord. <input type="checkbox"/> | Quality <input type="checkbox"/> | Thermoforming <input type="checkbox"/> | Finishing <input type="checkbox"/> | Rec/Store/Packaging <input type="checkbox"/> | Other <input type="checkbox"/> | Large Fab <input type="checkbox"/> | Composite <input type="checkbox"/> | Supplier <input type="checkbox"/> | |
| Skid-tube <input type="checkbox"/> | Crosstube <input type="checkbox"/> | Water Jet <input type="checkbox"/> | Engineering <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Machining <input type="checkbox"/> | Small Fab <input type="checkbox"/> | Prod. Eng. Coord. <input type="checkbox"/> | Quality <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Thermoforming <input type="checkbox"/> | Finishing <input type="checkbox"/> | Rec/Store/Packaging <input type="checkbox"/> | Other <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Large Fab <input type="checkbox"/> | Composite <input type="checkbox"/> | Supplier <input type="checkbox"/> | | | | | | | | | | | | | | | | |

| Root Cause | Date | Step | Qty | Description of work order update or non-conformance | Initial Chief Eng | Action Description | Sign & Date | Verification | QC Inspector |
|---------------|------|------|-----|---|-------------------|--------------------|-------------|--------------|--------------|
| Design | | | | | | | | | |
| Doc/Data | | | | | | | | | |
| Equip/Tooling | | | | | | | | | |
| Handling/Pre | | | | | | | | | |
| Material | | | | | | | | | |
| Operator | | | | | | | | | |
| Offset/Setup | | | | | | | | | |
| Process | | | | | | | | | |
| Supplier | | | | | | | | | |
| Training | | | | | | | | | |
| Transport | | | | | | | | | |
| Unapproved | | | | | | | | | |

FAULT CATEGORY

| | | | |
|--|--|---|--|
| Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube | General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function | <input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence | <input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other |
|--|--|---|--|

Work Order ID 119968

June-02-14 10:33:10 AM

119968

Page 4

Item ID: D212-664-101TRN

Accept

N900040100

Setup Start

NS1

Revision ID:

Item Name: Crosstube Turning Detail

Stop

NS2

Start Date: 6/02/14

Start Qty: 1.00

1

Cust Item ID:

Required Date: 6/02/14

Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run

Start

NR1

QC:

Date:

SPC (Y/N):

Date:

Stop

NR2

Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

160

QC5- Inspect part completeness to step on W/O

0.00

DAS

160

16

QC

Memo

0.00

9-89 14/06/26

Quality Control

170

Packaging

0.00

170

Packaging

Memo

0.00

Packaging

Identify and Stock in kanban rack
Location: LG

13L

14-06-26

180

QC21- Final Inspection - Work Order Release

0.00

180

QC

Memo

0.00

Quality Control

MLJ 14-06-27

MF
14-6-27

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

| | | | | | | | | | | | | | | | | | | |
|--|--|---|--------------------------------------|------------------------------------|------------------------------------|--------------------------------------|------------------------------------|------------------------------------|--|----------------------------------|--|------------------------------------|--|--------------------------------|------------------------------------|------------------------------------|-----------------------------------|--|
| Work Order: _____ Part No. _____ NCR No. _____ | DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/> | AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table> | Skid-tube <input type="checkbox"/> | Crosstube <input type="checkbox"/> | Water Jet <input type="checkbox"/> | Engineering <input type="checkbox"/> | Machining <input type="checkbox"/> | Small Fab <input type="checkbox"/> | Prod. Eng. Coord. <input type="checkbox"/> | Quality <input type="checkbox"/> | Thermoforming <input type="checkbox"/> | Finishing <input type="checkbox"/> | Rec/Store/Packaging <input type="checkbox"/> | Other <input type="checkbox"/> | Large Fab <input type="checkbox"/> | Composite <input type="checkbox"/> | Supplier <input type="checkbox"/> | |
| Skid-tube <input type="checkbox"/> | Crosstube <input type="checkbox"/> | Water Jet <input type="checkbox"/> | Engineering <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Machining <input type="checkbox"/> | Small Fab <input type="checkbox"/> | Prod. Eng. Coord. <input type="checkbox"/> | Quality <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Thermoforming <input type="checkbox"/> | Finishing <input type="checkbox"/> | Rec/Store/Packaging <input type="checkbox"/> | Other <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Large Fab <input type="checkbox"/> | Composite <input type="checkbox"/> | Supplier <input type="checkbox"/> | | | | | | | | | | | | | | | | |

| Root Cause | Date | Step | Qty | Description of work order update or non-conformance | Initial Chief Eng | Action Description | Sign & Date | Verification | QC Inspector |
|---------------|------|------|-----|---|-------------------|--------------------|-------------|--------------|--------------|
| Design | | | | | | | | | |
| Doc/Data | | | | | | | | | |
| Equip/Tooling | | | | | | | | | |
| Handling/Pre | | | | | | | | | |
| Material | | | | | | | | | |
| Operator | | | | | | | | | |
| Offset/Setup | | | | | | | | | |
| Process | | | | | | | | | |
| Supplier | | | | | | | | | |
| Training | | | | | | | | | |
| Transport | | | | | | | | | |
| Unapproved | | | | | | | | | |

FAULT CATEGORY

| | | | |
|--|--|---|--|
| Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube | General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function | <input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence | <input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other |
|--|--|---|--|

Picklist Print

June-02-14 10:33:13 AM

Page 1

Work Order ID: 119968

119968

Parent Item: D212-664-101TRN

D212-664-101TRN

Parent Item Name: Crosstube Turning Detail

Start Date: 6/02/14

Required Date: 6/02/14

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:A 08-03-06 new issue DD verified by:ec
IPP Rev B 08.04.02 removed Polish EC verified by: DD

| Component Item ID/ Item Name | Replacement Item ID | Mfg/ Purch | Bin Item | Primary Location | Last Location | Route Seq ID | Unit of Measure | Qty on Hand | Qty per Kit | Total Qty | Qty Issued | Date Issued | Status |
|---------------------------------|------------------------|---------------|-------------|---------------------|------------------|-----------------|--------------------|----------------|-------------|--------------|---------------|----------------|--------|
| D6005-128 | | Manufactured | No | | | 120 | Each | 101.0000 | 1 | 1 | | | |

D6005-128

Crosstube Material

| Location | Loc Qty | Loc Code |
|----------|---------|----------|
| LG | 4 | |
| 75646 | 4 | |
| LG003 | 97 | |
| 107871 | 23 | |
| 75631 | 20 | |
| 75638 | 8 | |
| 75642 | 46 | |

1 man. L 14/06/17

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

| | | | | | | | | | | | | | | | | | | |
|--|--|---|--------------------------------------|------------------------------------|------------------------------------|--------------------------------------|------------------------------------|------------------------------------|--|----------------------------------|--|------------------------------------|--|--------------------------------|------------------------------------|------------------------------------|-----------------------------------|--|
| Work Order: _____ Part No. _____ NCR No. _____ | DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/> | AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td style="width: 25%;">Skid-tube <input type="checkbox"/></td> <td style="width: 25%;">Crosstube <input type="checkbox"/></td> <td style="width: 25%;">Water Jet <input type="checkbox"/></td> <td style="width: 25%;">Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table> | Skid-tube <input type="checkbox"/> | Crosstube <input type="checkbox"/> | Water Jet <input type="checkbox"/> | Engineering <input type="checkbox"/> | Machining <input type="checkbox"/> | Small Fab <input type="checkbox"/> | Prod. Eng. Coord. <input type="checkbox"/> | Quality <input type="checkbox"/> | Thermoforming <input type="checkbox"/> | Finishing <input type="checkbox"/> | Rec/Store/Packaging <input type="checkbox"/> | Other <input type="checkbox"/> | Large Fab <input type="checkbox"/> | Composite <input type="checkbox"/> | Supplier <input type="checkbox"/> | |
| Skid-tube <input type="checkbox"/> | Crosstube <input type="checkbox"/> | Water Jet <input type="checkbox"/> | Engineering <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Machining <input type="checkbox"/> | Small Fab <input type="checkbox"/> | Prod. Eng. Coord. <input type="checkbox"/> | Quality <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Thermoforming <input type="checkbox"/> | Finishing <input type="checkbox"/> | Rec/Store/Packaging <input type="checkbox"/> | Other <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Large Fab <input type="checkbox"/> | Composite <input type="checkbox"/> | Supplier <input type="checkbox"/> | | | | | | | | | | | | | | | | |

| Root Cause | Date | Step | Qty | Description of work order update or non-conformance | Initial Chief Eng | Action Description | Sign & Date | Verification | QC Inspector |
|---------------|------|------|-----|---|-------------------|--------------------|-------------|--------------|--------------|
| Design | | | | | | | | | |
| Doc/Data | | | | | | | | | |
| Equip/Tooling | | | | | | | | | |
| Handling/Pre | | | | | | | | | |
| Material | | | | | | | | | |
| Operator | | | | | | | | | |
| Offset/Setup | | | | | | | | | |
| Process | | | | | | | | | |
| Supplier | | | | | | | | | |
| Training | | | | | | | | | |
| Transport | | | | | | | | | |
| Unapproved | | | | | | | | | |

FAULT CATEGORY

| | | | |
|--|--|---|--|
| Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube | General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function | <input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence | <input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other |
|--|--|---|--|


| | | | |
|---|--|---------------------|--------------|
| DART AEROSPACE LTD | | Work Order: | 119968 |
| Description: Crosstube Assembly (205/212/412 High Fwd) | | Part Number: | D212-664-141 |
| Inspection Dwg: D212-664-141 Rev: <i>E mm.l</i> | | Page 1 of 2 | |

FIRST ARTICLE INSPECTION CHECKLIST

| Inspection Sheet Drawing Dimension | | Tolerance | Actual Dimension | Accept | Reject | Method of Inspection | Comments |
|---------------------------------------|---------|---------------|---------------------|--------|--------|-------------------------|----------|
| SIDE A | 0.200 | +/-0.010 | .200 | / | | vern | CNC-08 |
| | R0.063 | +/-0.010 | .063 | / | | RG | |
| | 2.740 | +0.005/-0.000 | 2.741 | / | | mirr | CNC-04 |
| | 5.097 | +/-0.030 | 5.100 | / | | vern | CNC-08 |
| | 2.304 | +0.005/-0.000 | 2.309 | / | | mirr | CNC-04 |
| | 2.340 | +0.005/-0.000 | 2.345 | / | | ↓ | |
| | 2.398 | +0.005/-0.000 | 2.403 | / | | | |
| | 2.448 | +0.005/-0.000 | 2.453 | / | | | |
| | 2.498 | +0.005/-0.000 | 2.501 | / | | | |
| | 2.549 | +0.005/-0.000 | 2.553 | / | | | |
| | 2.599 | +0.005/-0.000 | 2.602 | / | | | |
| | 2.671 | +0.005/-0.000 | 2.673 | / | | | |
| | 2.701 | +0.005/-0.000 | 2.702 | / | | | |
| SIDE B | 0.200 | +/-0.010 | .200 | / | | vern | CNC-08 |
| | R0.063 | +/-0.010 | .063 | / | | RG | |
| | 2.740 | +0.005/-0.000 | 2.746 | / | | mirr | CNC-04 |
| | 5.097 | +/-0.030 | 5.100 | / | | vern | CNC-08 |
| | 2.304 | +0.005/-0.000 | 2.308 | / | | mirr | CNC-04 |
| | 2.340 | +0.005/-0.000 | 2.345 | / | | ↓ | |
| | 2.398 | +0.005/-0.000 | 2.403 | / | | | |
| | 2.448 | +0.005/-0.000 | 2.452 | / | | | |
| | 2.498 | +0.005/-0.000 | 2.501 | / | | | |
| | 2.549 | +0.005/-0.000 | 2.553 | / | | | |
| | 2.599 | +0.005/-0.000 | 2.602 | / | | | |
| | 2.671 | +0.005/-0.000 | 2.673 | / | | | |
| | 2.701 | +0.005/-0.000 | 2.702 | / | | | |
| | 126.514 | +/-0.020 | 126.534 | / | | tape | LG-11 |

| | | | |
|---|--|---------------------|--------------|
| DART AEROSPACE LTD | | Work Order: | 119 968 |
| Description: Crosstube Assembly (205/212/412 High Fwd) | | Part Number: | D212-664-141 |
| Inspection Dwg: D212-664-141 Rev: D | | Page 2 of 2 | |

WALL THICKNESS MEASUREMENT

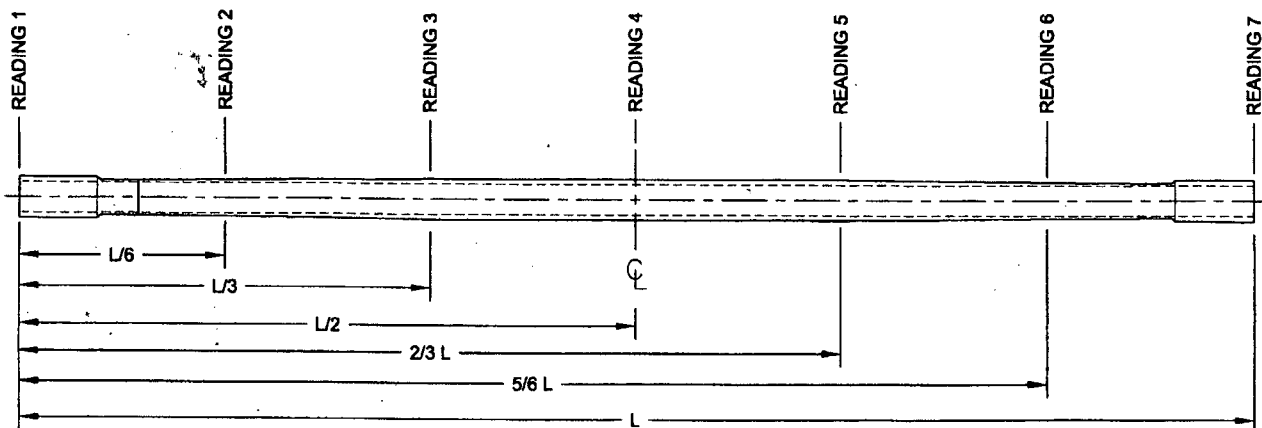

| Location | WALL THICKNESS MEASUREMENT (IN) | | | | Deviation Δw (max-min) | TOLERANCE |
|--------------------------|---------------------------------|-----|-----|-----|--------------------------------------|-----------|
| | w1 | w2 | w3 | w4 | | |
| READING 1 L = 0" | 408 | 397 | 354 | 360 | -.054 | 0.048" |
| READING 2 L = 21 | 271 | 266 | 216 | 217 | -.055 | |
| READING 3 L = 42 | 382 | 366 | 329 | 337 | -.053 | |
| READING 4 L = 63 | 409 | 389 | 357 | 367 | -.052 | |
| READING 5 L = 84 | 381 | 367 | 334 | 339 | -.047 | |
| READING 6 L = 105 | 267 | 261 | 227 | 228 | -.040 | |
| READING 7 L = 126.514 | 401 | 389 | 364 | 368 | -.037 | |

Dwg Δ

0.232 0.016
0.344 0.015
0.378 0.018

Calibration Result

Actual Block Thickness: 1100 - 750

Sitescan 250 Measured Thickness: 1100 - 750

| | |
|---------------------|----------|
| Measured by: | mm-l |
| Date: | 14/06/19 |

| | |
|--------------------|----------|
| Audited by: | JW |
| Date: | 14-06-21 |

| | |
|------------------------------|--|
| Preliminary Approval: | |
| Date: | |

| Rev | Date | Change | Revised by | Approved |
|-----|----------|--|------------|----------|
| A | 05.04.27 | New Issue (P/O D412-664-101) | KJ/JLM | |
| B | 06.03.15 | Tolerance revised for 5.097 per Dwg Rev update | KJ/JLM | |
| C | 07.05.28 | Dwg Rev updated | KJ/JLM | |
| D | 10.02.02 | Dimension 126.514 was 126.51 | KJ | |
| E | 12.06.04 | Wall thickness form added | KJ | |

| Item | Qty -141 | Qty -141B | Qty -141F | Part Number | Description |
|------|-------------|--------------|--------------|-----------------|---|
| 1 | X | | | D212-664-141 | CROSSTUBE ASSEMBLY (205/212/412 HIGH FWD) |
| 2 | | X | | D212-664-141B | CROSSTUBE ASSEMBLY (214 HIGH FWD) |
| 3 | | | X | D212-664-141F | CROSSTUBE ASSEMBLY (205/212/412 HIGH FWD) (ANODIZED) |
| 4 | 1 | 1 | 1 | D6005-128 | CROSSTUBE |
| 5 | 2 | | 2 | D2893-1 | SUPPORT |
| 6 | 4 | 4 | 4 | D3595-063-450 | RUBBER CUSHION |
| 7 | | 2 | | D5017-1 | SUPPORT |
| 8 | 4 | 4 | 4 | MS21920-25 | CLAMP (OR MS21920-26) |
| 9 | A/R | A/R | A/R | PROSEAL 890 B-2 | SEALANT, AMS-S-8802 CLASS B-2 |

GENERAL NOTES:

- 1) MATERIAL: MANUFACTURED FROM D6005-128
FINISHED LENGTH = 128.514±0.020
- 2) FINISH -141 & -141B: a) CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
b) PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
c) MASK UNDERSIDE OF CROSSTUBE AS SHOWN (ZN C6-2 / C6-3, HATCHED AREA)
d) PAINT OUTSIDE PER DART QSI 005 4.2
e) REMOVE MASKING AND APPLY MATTE CLEAR COAT
- FINISH -141F: a) ANODIZE PER MIL-A-8825, TYPE II, CLASS 1.
b) ALODINE (DO NOT ETCH) PER QSI 005 4.1.2
c) PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
d) MASK UNDERSIDE OF CROSSTUBE AS SHOWN (ZN C6-2 / C6-3, HATCHED AREA)
e) PAINT OUTSIDE PER DART QSI 005 4.2
f) REMOVE MASKING AND APPLY MATTE CLEAR COAT
- *NOTE: BETWEEN FINISHING OPERATIONS EXTREME CARE MUST BE TAKEN NOT TO CONTAMINATE OR DAMAGE FINISHED SURFACES.
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER "D212-664-XXX" AND BATCH NUMBER ON INSIDE OF CUFF USING VIBRATING STYLUS
- 7) WEIGHT: D212-664-141/-141B/-141F = 33.6 lbs
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.

MACHINING

- 10) RUN CUTTER OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.

BENDING

- 11) BEND PROGRESSIVELY WITH A MINIMUM OF 3 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 7.2% (BASED ON O.D.) IN LOWER HALF OF R35.5 BEND AND 6% (BASED ON O.D.) ON REMAINING TUBE.
- 12) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.

ASSEMBLY

- 13) TO INSTALL D2893-1 / D5017-1 SUPPORT: ABRASE MATING SURFACE OF SUPPORT AND CROSSTUBE WITH 180-GRIT SANDPAPER AND REMOVE RESIDUE WITH MEK (OR EQUIVALENT). APPLY A 0.04" TO 0.07" THICK LAYER OF PROSEAL 890 CLASS B-2 (OR AMS-S-8802 CLASS B-2) SEALANT TO MATING SURFACE OF SUPPORT.
- 14) INSTALL MS21920-25 CLAMPS (OR -26) WITH D3595-063-450 RUBBER CUSHIONS TO SECURE THE SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE ON TOP SIDE OF CROSSTUBE.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 119968 MJS

1406-02

RELEASED
2014-05-26
WJD

| | | | |
|------------|--|--|--------------|
| E | ADD -141F, D5017-1 WAS D2893-1 (-141B), PROSEAL WAS MAGNOBOND, NOTE 2: ADD INSPECTION WINDOW, NOTE 11: ALLOW 7.2% CRUSH, NOTE 15: ADD 72HR CURE AND RETORQUE FOR PROSEAL, ADD SHEET 3, CLAMPS REVERSED TO PREVENT CHAFING (B7-2, B7-3), BEND HEIGHT TOL. NOW 0.25 WAS 0.13 (C1-3), INCORP. DEO D-1/2/3 | CP | 14.04.01 |
| D | REFORMAT/REVISE GENERAL NOTES/PART LIST; REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS; ADD -141B (ZN B4-2, D4-2); REMOVED REF & ADD TOLERANCES (ZN B4-3, C6-3, C8-3 & B6-3); RELOCATED FLAG #6 PER PAR 08-046 (ZN A5-3); MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4 | RF | 09.09.30 |
| C | REMOVE -851 ABRASION STRIP; ADD MAGNOBOND 8398, CUSHION, REVERSE CLAMPS | PH | 07.03.08 |
| B | ADD HOLES FOR COMPATABILITY WITH BHT/AA SKIDTUBES | PH | 05.02.04 |
| A | NEW ISSUE | CP | 00.12.12 |
| REV. | DESCRIPTION | BY | DATE |
| DESIGN | DP | DART AEROSPACE LTD | |
| DRAWN | DP | HAWKESBURY, ONTARIO, CANADA | |
| CHECKED | DW | DRAWING NO. | REV. E |
| MFG. APPR. | JD | D212-664-141 | SHEET 1 OF 5 |
| APPROVED | JD | TITLE | SCALE |
| DE APPR. | JD | XTUBE ASS'Y (205/212/412 HI FWD) | NTS |
| DATE | 14.04.01 | COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL. NO REPRODUCTION OR DISSEMINATION OF THIS DOCUMENT IS TO BE MADE FOR ANY PURPOSE OR FOR ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD. | |

8 7 6 5 4 3 2 1

13 14 15
D2893-1 SUPPORT
MS21920-25 CLAMP, 2X
D3595-063-450 RUBBER CUSHION, 2X
2 PL

14.00

D212-664-501
BENT TUBE

2.0
1.0

MASK AREA PRIOR TO PAINTING,
REMOVE MASKING AFTER PAINT
AND APPLY CLEAR COAT

2.0

CL
SYM

D212-664-141/-141F
ASSEMBLY DETAIL

E MS21920-25
CLAMP, REF
14 15

D2893-1
SUPPORT, REF

E 13
APPLY PROSEAL
BETWEEN D2893-1 AND
CROSSTUBE



D3595-063-450
RUBBER CUSHION
UNDER CLAMP, REF

SECTION A-A
SCALE 4X

RELEASED
2014-05-26

| | | | |
|------------|----------|--|--------------|
| DESIGN | Q | DART AEROSPACE LTD | |
| DRAWN | Q | HAWKESBURY, ONTARIO, CANADA | |
| CHECKED | Q | DRAWING NO. | REV. E |
| MFG. APPR. | Q | D212-664-141 | SHEET 2 OF 5 |
| APPROVED | Q | TITLE | SCALE |
| DE APPR. | Q | XTUBE ASS'Y (205/212/412 HI FWD) | NTS |
| DATE | 14.04.01 | COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD. | |

8 7 6 5 4 3 2 1

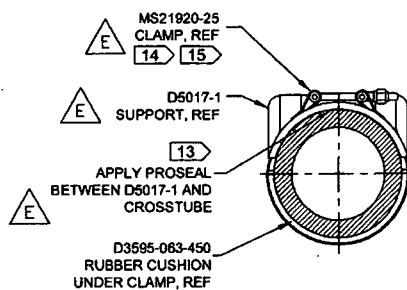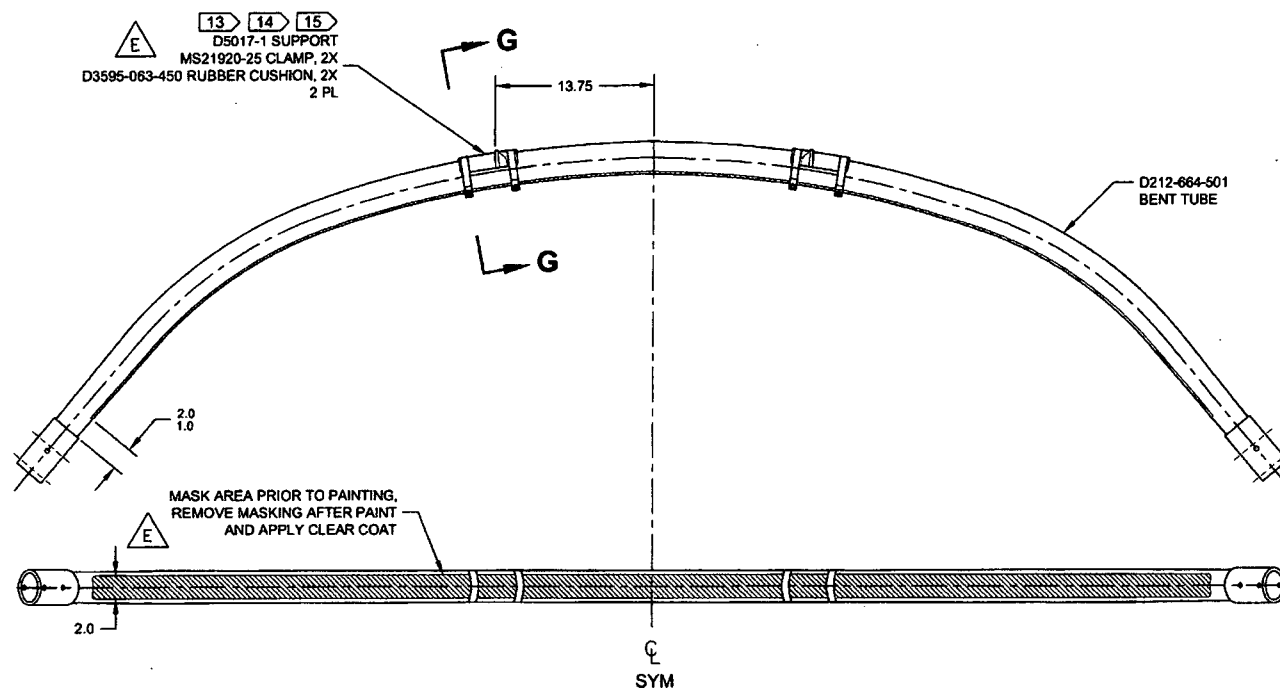


SECTION G-G
SCALE 4X


D212-664-141B
ASSEMBLY DETAIL

RELEASED
2014-05-26


| | | | |
|------------|----------|--|--------------|
| DESIGN | | DART AEROSPACE LTD | |
| DRAWN | | HAWKESBURY, ONTARIO, CANADA | |
| CHECKED | | DRAWING NO. | REV. E |
| MFG. APPR. | | D212-664-141 | SHEET 3 OF 5 |
| APPROVED | | TITLE | SCALE |
| DE APPR. | | XTUBE ASS'Y (205/212/412 HI FWD) | NTS |
| DATE | 14.04.01 | <small>COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small> | |

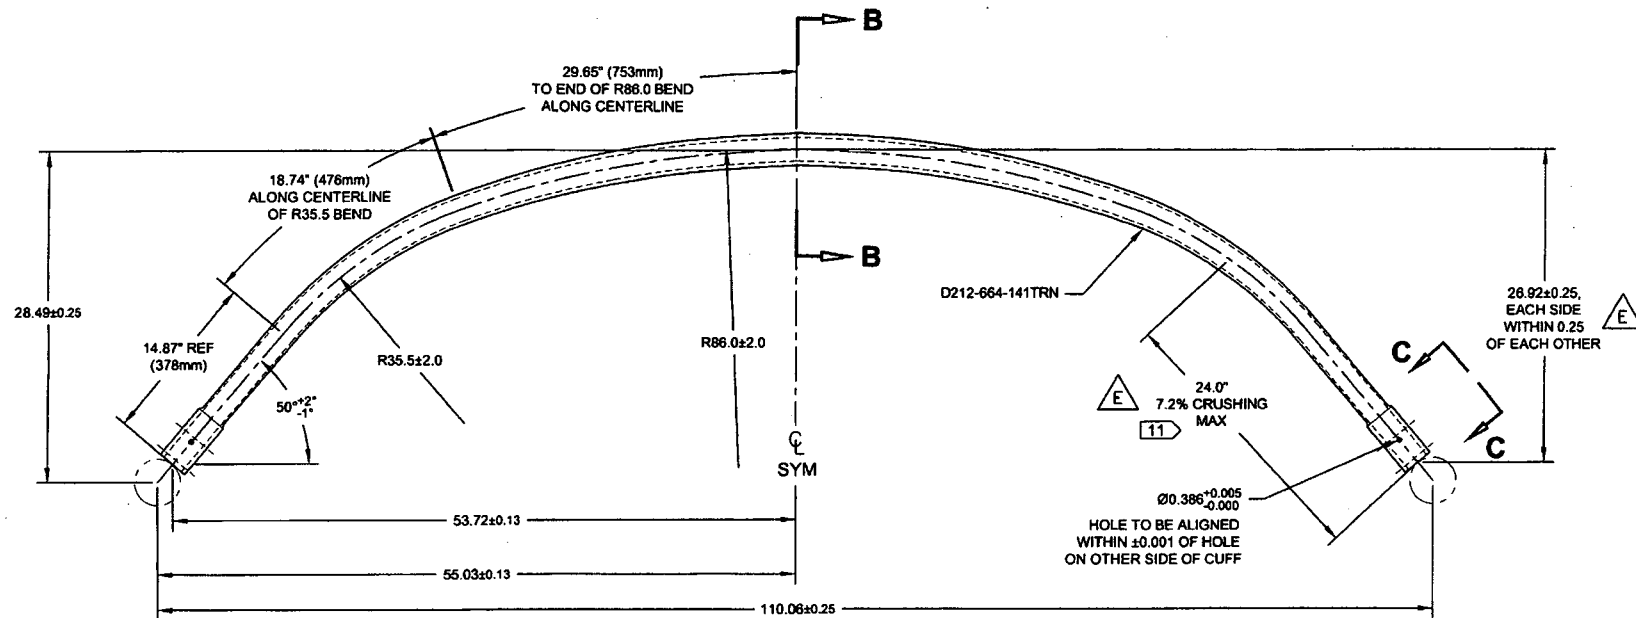

D212-664-501
BENDING AND DRILLING DETAIL 11

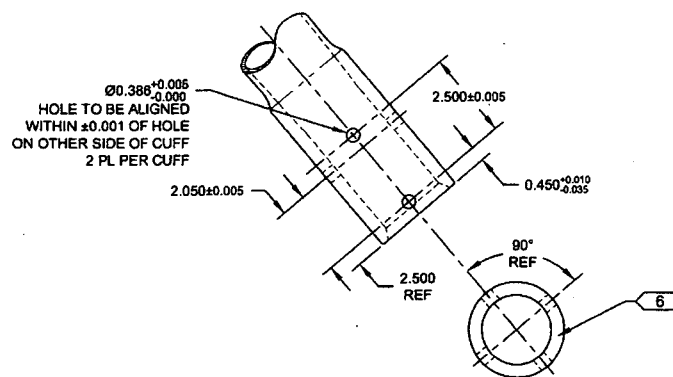





VIEW C-C: CUFF DETAIL
SCALE 3X

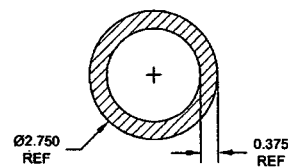

SECTION B-B
SCALE 4X

RELEASED
 2014-05-26

| | | | |
|------------|----------|--|--------------|
| DESIGN | 92 | DART AEROSPACE LTD | |
| DRAWN | 92 | HAWKESBURY, ONTARIO, CANADA | |
| CHECKED | 92 | DRAWING NO. | REV. E |
| MFG. APPR. | 92 | D212-664-141 | SHEET 4 OF 5 |
| APPROVED | 92 | TITLE | SCALE |
| DE APPR. | 92 | XTUBE ASS'Y (205/212/412 HI FWD) | NTS |
| DATE | 14.04.01 | COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL. IT IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMERCIALIZED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD. | |

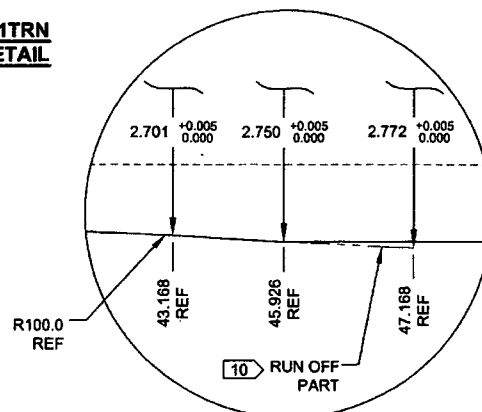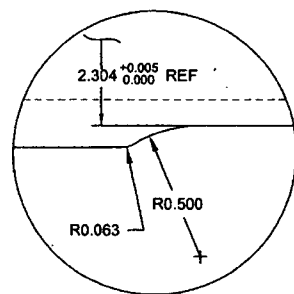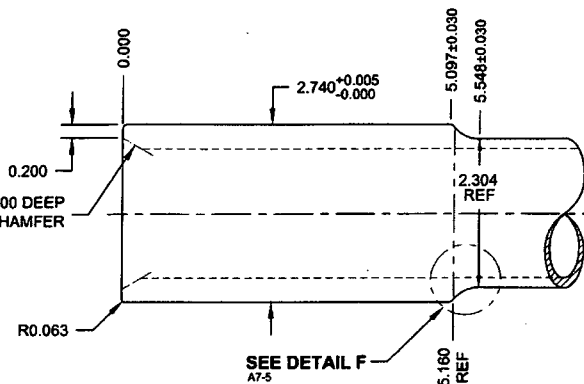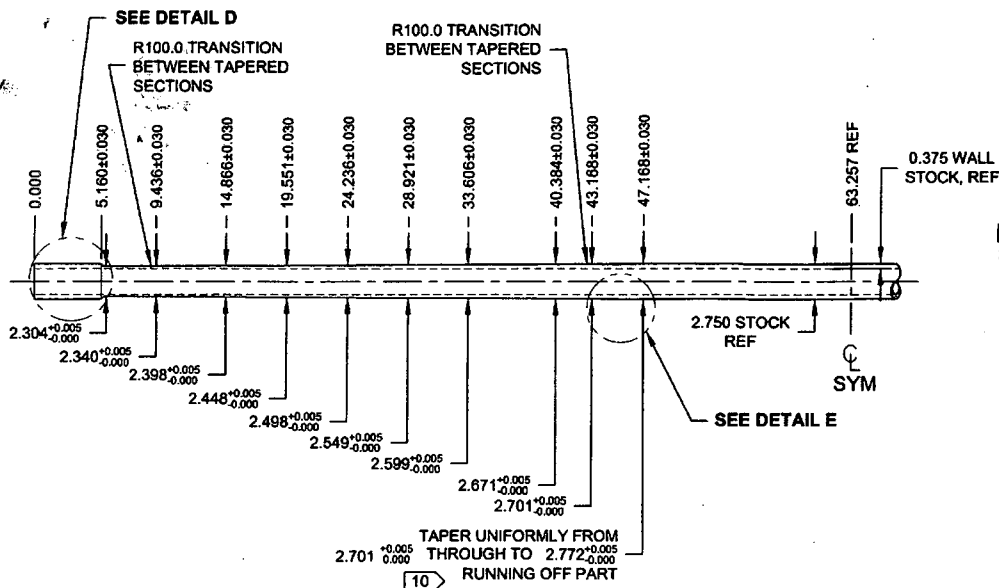

RELEASED
2014-05-26

| | | | |
|------------|----------|---|--------------|
| DESIGN | | DART AEROSPACE LTD | |
| DRAWN | | HAWKESBURY, ONTARIO, CANADA | |
| CHECKED | | DRAWING NO. | REV. E |
| MFG. APPR. | | D212-664-141 | SHEET 5 OF 5 |
| APPROVED | | TITLE | SCALE |
| DE APPR. | | XTUBE ASS'Y (205/212/412 HI FWD) | NTS |
| DATE | 14.04.01 | <small>COPYRIGHT © 2009 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESSED CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD</small> | |

